



A Mahindra Aerospace Company

PO Box 881, Morwell, Victoria 3840, Australia

Ph + 61 (0) 3 5172 1200

Fax + 61 (0) 3 5172 1201

www.gippsaero.com

SB-GA8-2009-60

Issue 2

MANDATORY

Service Bulletin

Subject:

Replacement of Exhaust Support Strap

Applicability:

All normally aspirated GA8 serial numbers GA8-00-004 through GA8-09-139. (Not applicable to GA8-TC 320 serial numbers.)

Amendments:

Issue 1: Nil

Issue 2: Updated Service Bulletin to mandatory. Compliance section updated to reflect this.

Background:

Service experience has shown that movement of the mufflers can result in fretting damage to the nose leg support braces, firewall shield or engine mount frame. The replacement exhaust support strap locates the muffler more rigidly but allows for adequate vibration dampening.

Compliance:

This Service Bulletin must be incorporated at next scheduled maintenance.

Weight and Balance:

Negligible effect on weight and balance.

Approval:

This modification has been approved pursuant to Regulation 21.095 of CASR(1998).

Parts:

Item	Part Number	Description	Qty
1	GA8-710021-131	Exhaust Support Strap	2

Parts Availability:

New parts can be obtained directly from GippsAero.

Tel.: +61 03 5172 1200

Fax: +61 03 5172 1201

Email: spares@gippsaero.com

Labour:

1 hour should be allocated to the incorporation of this service bulletin.

Warranty:

Not applicable.

Instructions:

1. Remove muffler support Strap (GA8-710021-31) as shown in Figure 1.

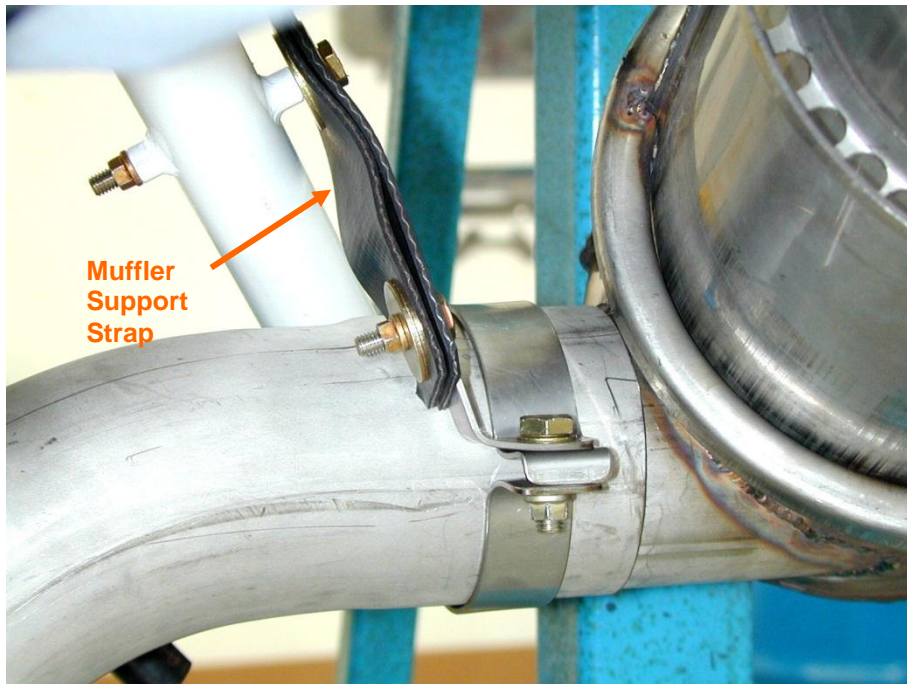


Figure 1

2. Using the existing hardware, install new Muffler Support Strap (GA8-710021-131) as shown in Figure 2.



Figure 2

Documentation:

Update aircraft log book to reflect incorporation of this Service Bulletin.

Compliance Notice:

Complete the Document Compliance Notice and return to GippsAero by mail, fax or email.

DOCUMENT COMPLIANCE NOTICE



A Mahindra Aerospace Company

Document:

SB-GA8-2009-60

Issue 2

MANDATORY

Aircraft Serial Number: _____

Aircraft Registration: _____

Incorporation Date: _____

Incorporated by: _____

I certify that SB-GA8-2009-60 Issue 2 has been incorporated in the aircraft specified in this Document Compliance Notice

Signed

Please email, post or fax this Document Compliance Notice to:

GippsAero
Attn: Technical Publications
P.O. Box 881
Morwell, Victoria 3840
Australia
Fax: +61 03 5172 1201
Email: techpubs@gippsaero.com